



K-3 電接點壓力表

Pressure Gauges With Electric Contacts


EDT, EAT



油壓記號
SYMBOL

選購指南 HOW TO ORDER

EAT	-100	-100K	-A1	-T	-04	-1
系列編號 SERIES NUMBER EAT:直入式 EAT:VERTICAL MOUNTING EDT:埋入式 EDT:HORIZ- ONTAL MOUNTING	直徑 DIAL SIZE (mm) 100φ 75φ	壓力範圍 PRESSURE RANGE (kg/cm ²) 35-500	安裝形式 MOUNTING TYPE A1:直入式 A1:VERTICAL MOUNTING B2:埋入式 B2:HORIZ- ONTAL MOUNTING	接頭形式 CONNECTION TYPE T: PT	接頭尺寸 CONNECTION SIZE 02:1/4" (75φ) 04:1/2" (100φ)	接頭形式 詳如下表 CONNECTION TYPE 1-8 AS BELOW LIST

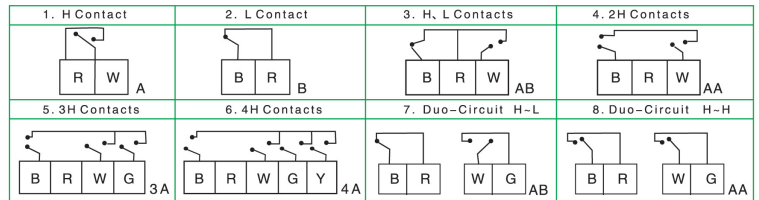

接線說明\ EARTH CONNECTED LINE: 1.H Contact:Black 黑 2.L Contact:White 白 3.H-LContacts:Green 綠 4.2HContact:Green 綠 5.3HContacts&Duo-Circuit:Yellow 黃 6.4HContacts:Blue 藍

注\REMARKS:A:常開 Normal Open B:常閉 Normal Close

K-4 甘油式壓力表

Glycerine Pressure Gauges

AT, DT



油壓記號
SYMBOL

選購指南 HOW TO ORDER

AT	-63	-100K	A1	-T	-02
系列編號 SERIES NUMBER AT:直入式 AT:VERTICAL MOUNTING DT:埋入式 DT:HORIZ- ONTAL MOUNTING	通徑 DIAL SIZE(mm) 63φ 100φ	壓力範圍 PRESSURE RANGE (kg/cm ²) 35-500 3.5-50Mpa	安裝形式 MOUNTING TYPE A1:直入式 A1:VERTICAL MOUNTING B1:埋入式 B1:HORIZ- ONTAL MOUNTING	接頭形式 CONNECTION TYPE T:PT P:PF N:NPT	接頭尺寸 CONNECTION SIZE 02:1/4" (for 63) 03:3/8" (for 100) 04:1/2" (for 100)

性能表 SPECIFICATION

型號 MODEL	壓力範圍 PRESSURE RANGE (kgf/cm ²)	面徑 DIAL SIZE	管牙 PT	耐溫℃ MAX.TEMP- ERATURE				
AT-63	35	2 1/2" (63m/m)	1/4"	60℃				
	50							
	70							
	100							
	150							
AT-100	250	4" (100m/m)	3/8"	60℃				
	350							
	500							
	DT-63				35	2 1/2" (63m/m)	1/4"	60℃
					50			
70								
100								
150								
DT-100	350	4" (100m/m)	3/8"	60℃				
	350							
	500							